



FAG

Service Info



Change of design to protective dust cover

Part replacement - RIU: 566283.H195 replaced with 566283.01.H195

Manufacturers: DAF

Wheel hubs
OE number: 1657637
1391617
1818003
1812161

Wheel bearing
Old part number: 566283.H195
New part no.: 566283.01.H195



Image 2: New version (566283.01.H195)

During fitment of Repair Insert Unit (RIU) part number 566283.H195, the protective dust cover may become twisted on some wheel hubs. In the worst case scenario, a twisted protective dust cover may cause a bearing to become obstructed, thereby making it difficult for the wheel hub to turn or prevent it from turning altogether.

For this reason, a modified protective dust cover has been developed (see image 1).

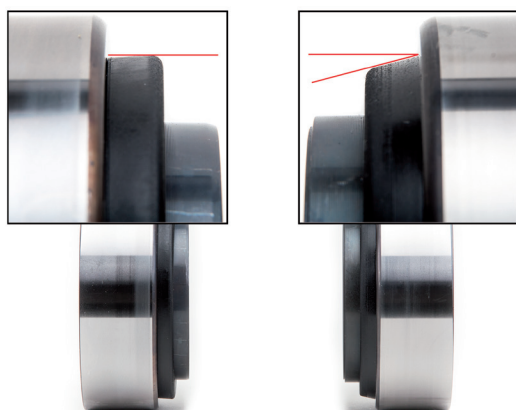


Image 1: The design of the dust-protection cover has been changed

As a result of this technical modification, part number 566283.H195 has been replaced with 566283.01.H195.

The vehicle manufacturer has also superseded the affected original equipment wheel hubs. Originally, wheel hubs with the following OE numbers existed: 1657637, 1391617, 1818003, 1812161. These have now been replaced by numbers 1818003 and 1812161 only.

On both wheel hubs, measurement and installation testing has been performed successfully using the new RIUs.

Please observe the vehicle manufacturer specifications!

You want more? We can help!

Phone: +44 (0) 1432 264 264*

Fax: +44 (0) 1432 375 760

hfd-info@schaeffler.com

www.schaeffler-aftermarket.co.uk

* Calls from within the UK 08457 001100



SCHAEFFLER
AUTOMOTIVE AFTERMARKET