

IMPORTANT PLEASE READ THE INFORMATION BELOW BEFORE FITTING THIS
PART AS THERE ARE KNOWN ISSUES WHICH WILL RESULT IN THE
PREMATURE FAILURE OF THE UNIT AND MAY INVALIDATE YOUR WARRANTY

There is a known fault with the vehicle that this alternator is fitted to which results in the cooling fan running on after the maximum cut off time of 12 minutes.

This fault can cause the vehicle's battery to discharge and result in excessive load being exerted to the alternator causing components to fail.

The cause of the failure is due to water ingress into the engine control relay which causes damage to terminal 87 in the engine fuse box. In order to rectify the failure it is recommended that the connections are checked for damage and the wire is repaired. Also test the engine control relay and replace if faulty.

Failure to the above faults will cause failure of the replacement alternator and invalidate your warranty.

FREE vehicle specific technical information available at autoelectro.co.uk



Vehicle specific information is available by searching the vehicle details via our website or scanning this QR code



