


# Solution

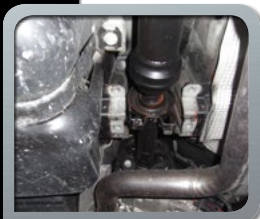

## Cost-effective repair solutions!

In the VW Touareg and the Porsche Cayenne, cracking noises may be heard and strong vibrations felt in the passenger compartment, depending on the load. One reason for this may be a defective or worn prop shaft centre bearing. The rubber of the bearing may split due to wear and tear, leading to the noises and vibrations mentioned. This leaves the bearing unable to support the prop shaft and as a result should be replaced.

### SWAG has the solution for a timely and efficient repair:

The prop shaft center bearing is also available separately!

This saves customers money because naturally a single component is cheaper than a complete unit.

Fits:

VW Touareg up to year of construction 2010

Porsche Cayenne up to year of construction 2010

**SWAG no. 30 93 8548**

Repl. number 955 421 020 14 SK

Repl. number 7L0 521 102 N SK



#### Note!

The prop shaft centre bearing is not available separately from the manufacturer and can only be ordered with the complete prop shaft. This makes the repair very expensive.

Register now for the official SWAG newsletter and receive the latest technical information automatically by email! Further information may be obtained at: [www.swag.de](http://www.swag.de)

Simply ask for spare parts by SWAG. The complete range can be found at: [www.swag-parts.de](http://www.swag-parts.de)