

febiEXAKT



Knuckle assembly for ABS

febi no. 19100


Repl. no. 655 332 02 01

to fit
Mercedes-Benz



>> PROBLEM:

The ABS ring brushes against the knuckle assembly at the height of the ABS sensor. If the material wear of the ring is at an advanced stage, the sensor cannot measure the ABS signal properly any more.

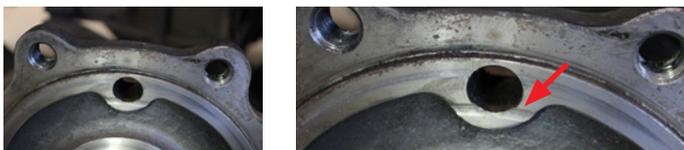

>> CAUSE:

In the first version, the distance that the OE had envisaged between the knuckle assembly and the ABS ring was too small. Therefore, the ABS ring used to brush against the knuckle assembly during movement of the vehicle.

Owing to the problems that occurred, a technical adjustment was made. However, the original number was not changed, so that a distinction cannot be made between the old and the new version.

>> SOLUTION:

febi bilstein offers the new version machined in its in-house facilities, under the febi number 19100. As an alternative for vehicles without an ABS system, the old version of the knuckle assembly will continue to be offered under the febi special number 81555.



febi no. 19100

febi no. 81555