

Product info sheet


Robert Bosch

0445116025

Special tools needed?

Yes

Use special tool to turn the coupling nut.

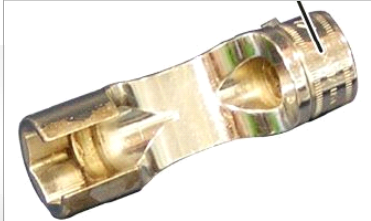

Product specific information

Programming

Yes

IMA code (7 characters)

Unlocking

No

Adaption values reset

No

Bleed

Yes

ignition on for 30 seconds

adjustment at mounting_1

No

adjustment at mounting_2



Tightening torques

Injector/ retaining clamp

7 Nm + 90° + 90°

High Pressure pipe nuts

33 Nm

Assembly instructions

Replace sealing washer

Recommendation: replace fuel filter

Replace tension bolts

Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.

