



# AUTOELECTRO

Since 1986

## STARTER MOTORS & ALTERNATORS

**IMPORTANT PLEASE READ THE INFORMATION BELOW BEFORE FITTING THIS PART AS THERE ARE KNOWN ISSUES WHICH WILL RESULT IN THE PREMATURE FAILURE OF THE UNIT AND MAY INVALIDATE YOUR WARRANTY**

**NISSAN Starter Motor - AEY2687**

**MICRA 1.2 PETROL 10 - 17**

**NOTE 1.2 PETROL 13 - 18**

On models with a push start ignition switch, the switch can remain in the pressed ON position and does not return after the engine has started.


Please check the starter motor for obvious signs of being burnt out

- Blue colour on armature shaft near pinion
- Rattling inside motor when starter motor is shaken
- Burnt smell from starter motor
- Damaged teeth on starter motor
- Varnish leaked from starter motor



A modified push start button (Nissan 25150-1HA2A) must be fitted if required and all wiring checked before replacing the starter motor.

**FREE vehicle specific technical information available at [autoelectro.co.uk](http://autoelectro.co.uk)**

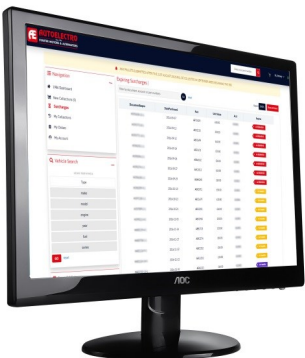

Vehicle specific information is available by searching the vehicle details via our website or scanning this QR code



***Fit and Forget!***