

Product info sheet

VDO

03G130073SX

Special tools needed?

Yes

universal slide-puller to lift injectors carefully

Product specific information

Programming

No

Unlocking

No

Adaption values reset

No


Bleed

No

adjustment at mounting_1

Yes

Cam on top, adjusting screw clockwise to stop, anticlockwise 180°

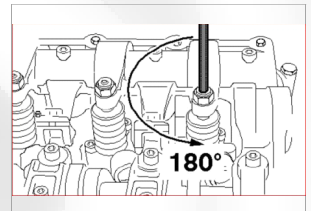

adjustment at mounting_2

Tightening torques

Injector/ retainingclamp

3 Nm + 90° + 180°

Bolts rockershaft

20 Nm + 90°

Locknut adjusting screw

30 Nm

Assembly instructions

Press firmly before tightening

Replace adjusting screw rocker

Replace bolts rockershaft

Replace tension bolts

Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.