

## Product info sheet

Robert Bosch

0445116059

Special tools needed?

Yes

Use special tool to turn the coupling nut.



## Product specific information

Programming

Yes

IMA code (7 characters)

Unlocking

No

Adaption values reset

No


Bleed

Yes

ignition on for 30 seconds

adjustment at mounting\_1

--

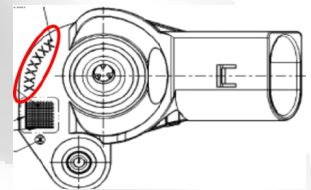

adjustment at mounting\_2

## Tightening torques

Injector/ retaining clamp

1: 8 Nm, 2: 26 Nm

High Pressure pipe nuts

25 Nm

## Assembly instructions

Recommendation: replace fuel filter

Replace sealing washer

### Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.

